




## **Specifications**



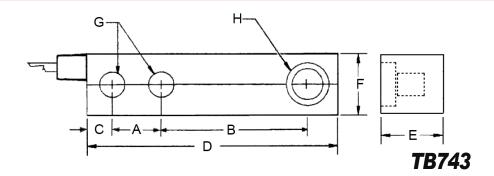

# **TB743** TOTALCOMP SHEAR BEAM LOAD CELL

The Totalcomp TB743 series beam load cells are ideal replacements for Toledo 743 Flexmount load cells. They are built to meet or exceed all manufacturers specs for this type of cell. They are constructed from Stainless Steel for washability and protection from harsh environments. Flexmount is a registered trademark of Mettler Toledo.

Part Number	Capacity	Weight	Α	В	С	D	Е	F	G	н
TB743-1K	1,000 lb	6 lb	2.500	3.880	0.620	7.993	1.450	1.463	0.500	1.200
TB743-3K	3,000 lb	6 lb	2.500	3.880	0.620	7.993	1.450	1.463	0.500	1.200
TB743-5K	5,000 lb	6 lb	2.500	3.880	0.620	7.993	1.450	1.463	0.500	1.200
TB743-10K	10,000 lb	9 lb	2.625	4.860	0.754	9.250	2.059	2.059	0.767	1.480
TB743-20K	20,000 lb	18 lb	3.250	5.419	1.035	11.000	2.375	2.335	1.036	1.835

#### Performance

Full Scale Output 2.00 mV/V Overload Safe 150% FS

Electrical

Overload Ultimate 150% FS

Bridge Resistance

Excitation Voltage 10 VDC (15VDC Max)

Input 350 ohms

Output 350 ohms

Insulation Resistance 10KMohms@50VDC

Combined Error ±0.05% FS

Nonlinearity ±0.05% FS

Hysteresis

±0.05% Creep ±0.03% FS in 20 min

Non-Repeatability

±0.02% FS Zero Balance

±1% FS

### Temperature

Compensated Range -10°C to +40°C

Temperature Operating Range -10°C to +40°C

Effect on Zero Balance 0.003% FS/deg F

Effect on FS Output 0.002% FS/deg F

#### Mechanical

Material Stainless Steel

Finish Polished Sealing Hermetic Wiring

Cable Length & Type 20 foot, 4 conductor

Cable Color Code + Excitation......Green - Excitation.....Black + Output.....White - Output....Red Shield....Yellow

## TOTALCOMP LIMITED WARRANTY

**Totalcomp** warrants this product to be free of defects in materials and/or workmanship and suitable for the purpose(s) intended as outlined on this sheet. This warranty is effective and shall cover the purchaser for one year from the date of shipment from our plant. If this product is found to be defective by our inspection in accordance with the above listed criteria, we will replace or repair it at our expense. For warranty service, please obtain a return authorization number from us and return the item, shipping prepaid, with a written description of the problem. We will respond promptly with the results of our evaluation.

